




Canvas Dock Base® Peninsula Installation and Disassembly for Recycling Instructions

Parts Included:

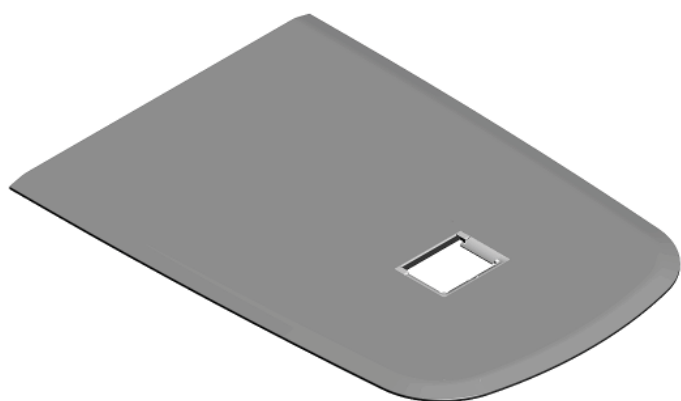

A Work Surface
(FDS60)
(FDT60)
(FDE60)



B Flipper Door



D Power Tap



C Bottom Pan



E Grommet (2)



F Rubber Pad



J #10-12 x 5/8 lg Pan Hd Tapping Screw (6)



L #10-12 x 3/4 lg Pan Hd Tapping Screw (14)




K #8-32 x 1/2 lg Flat Hd Screw (2)



N #10-12 x 5/8 lg Flat Hd Tapping Screw (8)

Hardware Pack

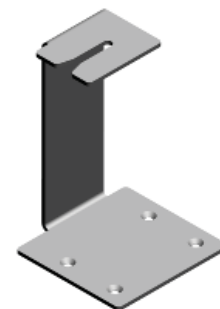

H Tether Bracket(2)



G Wire Trough



M Thumb Screw(2)

(FD600)




P Dock to Surface Tether



R 10-12 x 7/8 Flat Hd Tapping Screw (5)

Hardware Pack

(FD290)

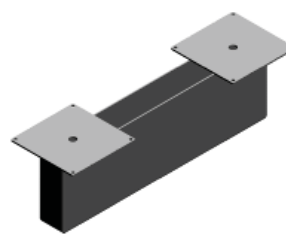

S Surface Support



L #10-12 x 3/4 lg Pan Hd Tapping Screw (8)

(FT298_M)


HermanMiller

© 2012 Herman Miller, Inc. Zeeland, Michigan. Printed in the U.S.A.
Part no. 1BDZ3Y rev A.


™, ®, HermanMiller, Canvas are among the trademarks of Herman Miller, Inc.

Illustrations and specifications are based on the latest product information available at the time of publication.
The right is reserved to make changes in design and specifications at any time, without notice, and also to discontinue products.

Tools Required:

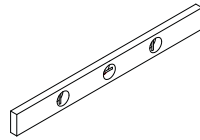

Level




Power Driver




#2 Phillips Bit




1/8" Drill Bit

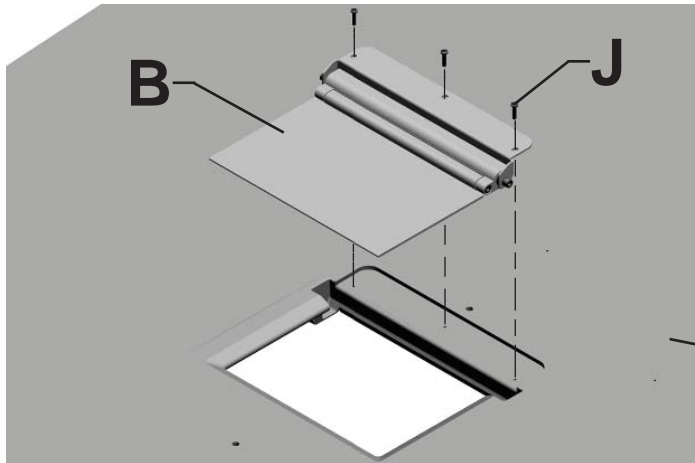

1. Place Peninsula Work Surface (A) upside down on a clean padded surface.
2. Position Flipper Door (B) into opening in work surface.
3. Install 3 pan head screws (J).

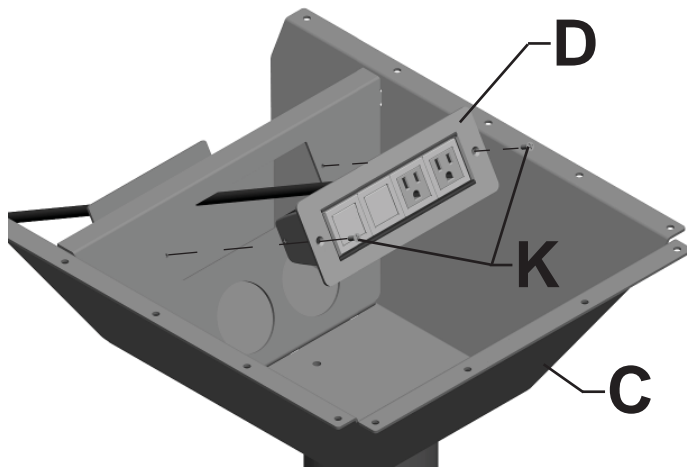

4. Insert Power Tap (D) into cutout in Bottom Pan (C).
5. Install 2 flat head screws (K).

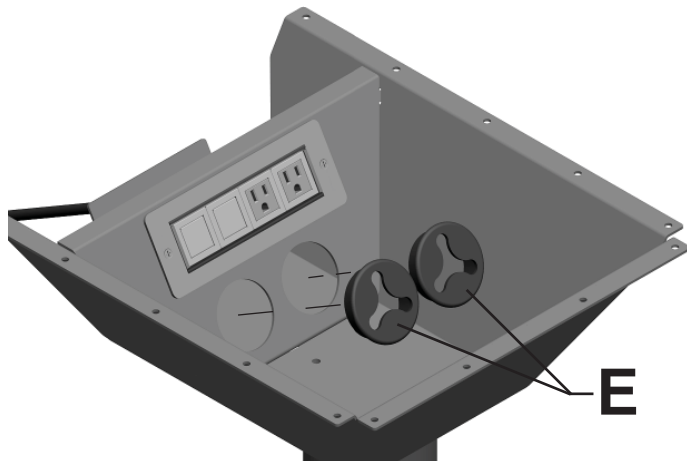

6. Press 2 grommets (E) into openings in Bottom Pan.

HermanMiller


© 2012 Herman Miller, Inc. Zeeland, Michigan. Printed in the U.S.A.

Part no. 1BDZ3Y rev A.

TM and [®] Herman Miller, Canvas are among the trademarks of Herman Miller, Inc.

Illustrations and specifications are based on the latest product information available at the time of publication.


The right is reserved to make changes in design and specifications at any time, without notice, and also to discontinue products.

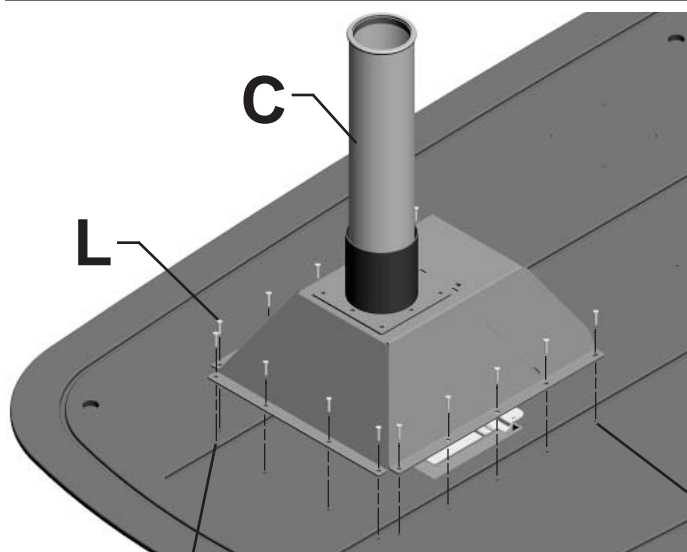

7. Place Bottom Pan (C) over opening in work surface.
8. Align pilot holes in work surface with holes in Bottom Pan.
9. Install 14 pan head screws (L).


Pilot Holes

Pilot Holes

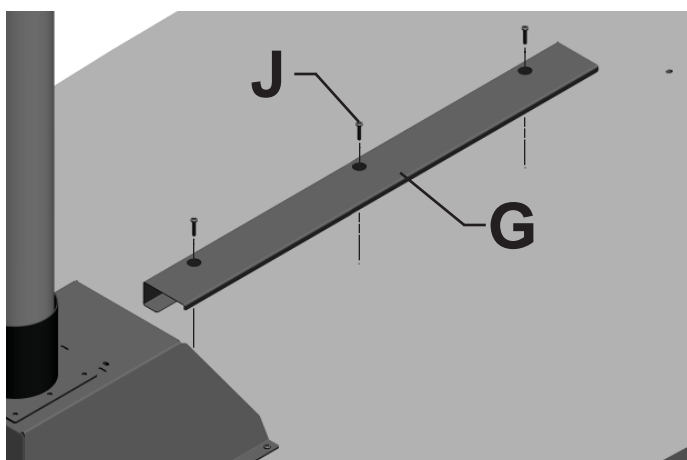

10. Position Wire Trough (G) over pilot holes in work surface.
11. Install 3 pan head screws (J).

Storage Mounted Peninsula:

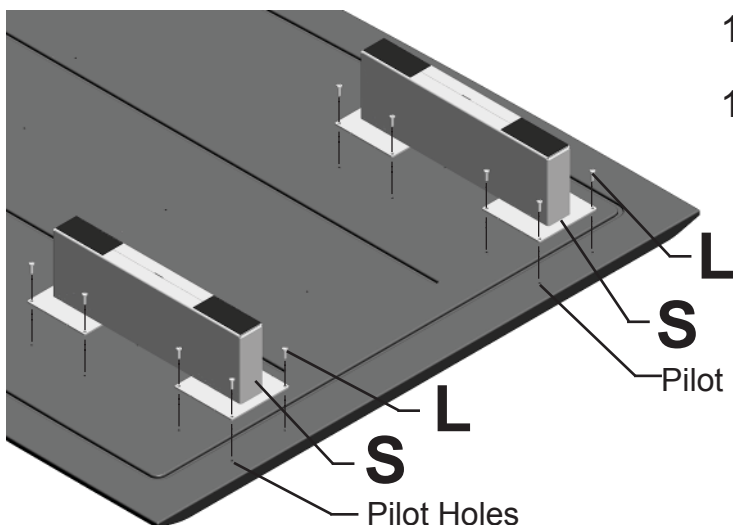

12. Position two Surface Supports (S) over Pilot holes in work surface.
13. Install using pan head screws (L) provided with Surface Support.

HermanMiller

© 2012 Herman Miller, Inc. Zeeland, Michigan. Printed in the U.S.A.


Part no. 1BDZ3Y rev A.

™, ®, Herman Miller, Canvas are among the trademarks of Herman Miller, Inc.


Illustrations and specifications are based on the latest product information available at the time of publication.

The right is reserved to make changes in design and specifications at any time, without notice, and also to discontinue products.

14. Remove tops from credenzas where peninsula is to be installed.

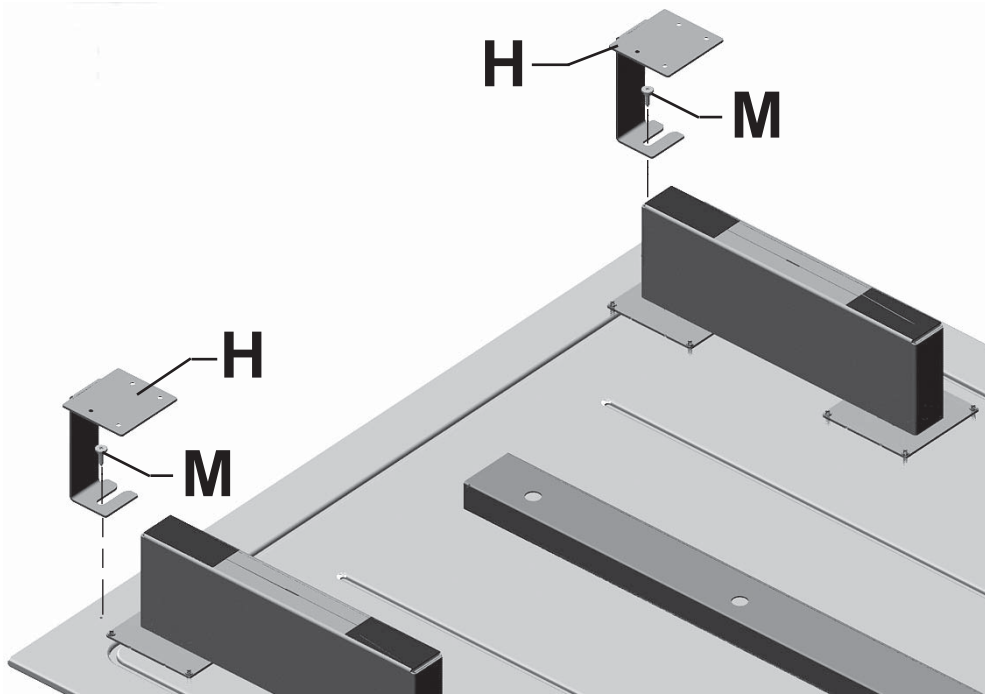

15. Assemble Tether Brackets (H) to Peninsula Surface with Shoulder Screws (M).

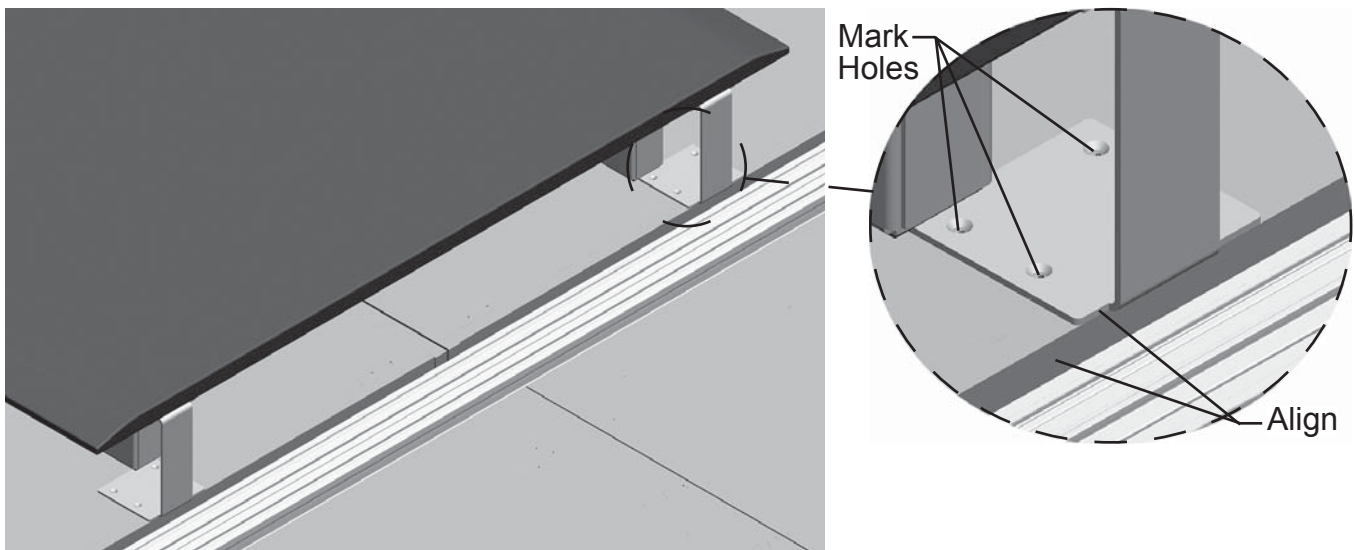

16. Place peninsula upright and position onto credenza.

17. Align back edge of Tether Brackets with back of credenzas.

18. Mark hole location on credenzas.

19. Remove peninsula from credenzas.

20. Remove Tether Bracket from peninsula.

21. Drill 1/8" diameter pilot holes in credenzas.

HermanMiller



© 2012 Herman Miller, Inc. Zeeland, Michigan. Printed in the U.S.A.

Part no. 1BDZ3Y rev A.


TM ®, [®] Herman Miller, Canvas are among the trademarks of Herman Miller, Inc.

Illustrations and specifications are based on the latest product information available at the time of publication.

The right is reserved to make changes in design and specifications at any time, without notice, and also to discontinue products.

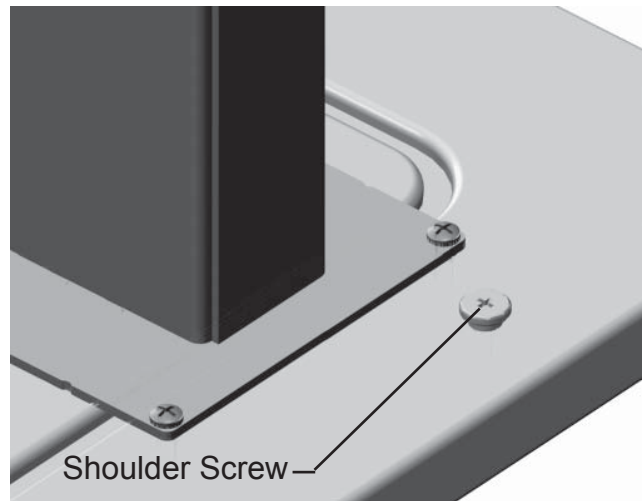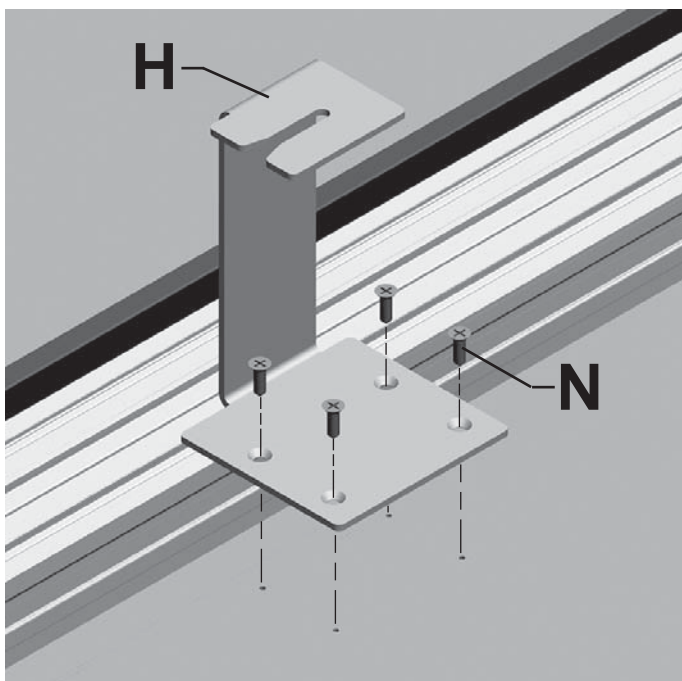

22. Attach Tether Bracket (H) to credenza with flat head tapping screws (N).
23. Keep Shoulder Screws loose in peninsula surface.

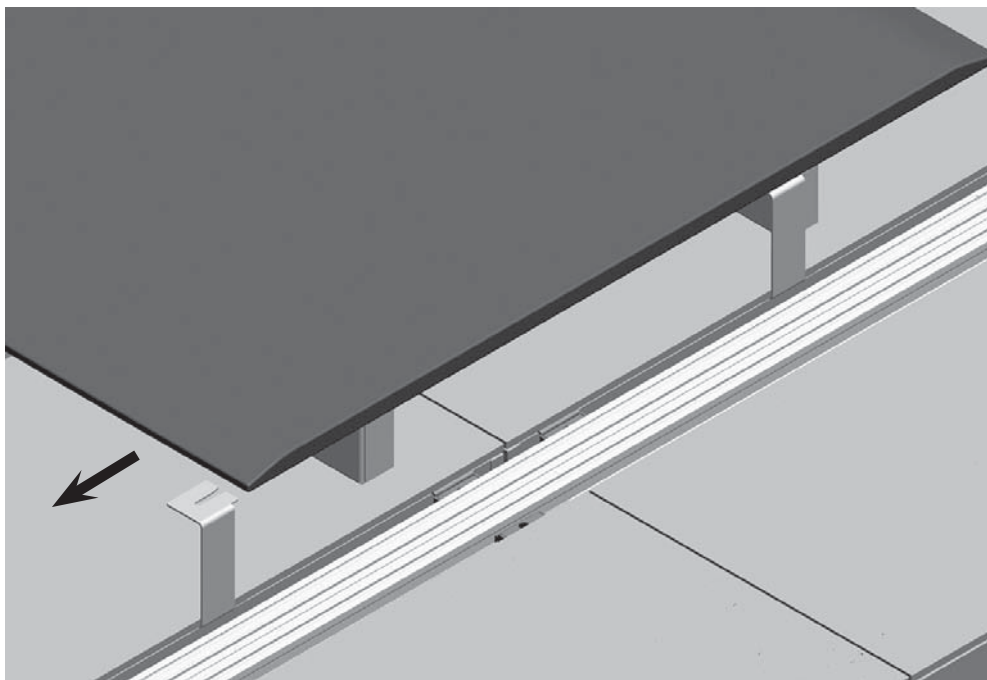

24. Return tops to credenzas.
25. Place peninsula surface onto credenzas. Slide surface over to engage tether brackets with shoulder screws. (Sheet of paper under stanchion pad makes top easier to slide.) Tighten shoulder screws.

HermanMiller

© 2012 Herman Miller, Inc. Zeeland, Michigan. Printed in the U.S.A.



Part no. 1BDZ3Y rev A.

TM ® HermanMiller, Canvas are among the trademarks of Herman Miller, Inc.



Illustrations and specifications are based on the latest product information available at the time of publication.

The right is reserved to make changes in design and specifications at any time, without notice, and also to discontinue products.


Dock Mounted Peninsula:

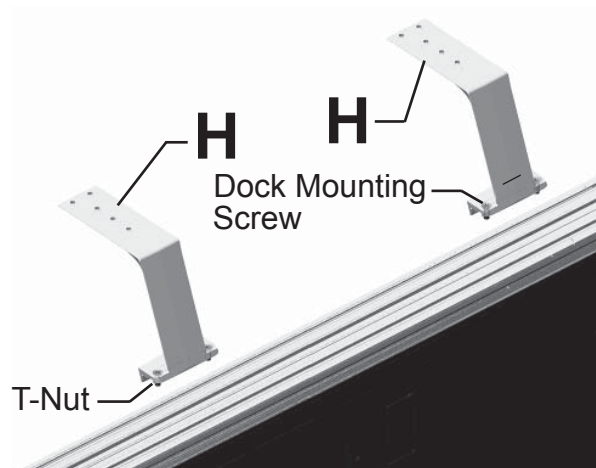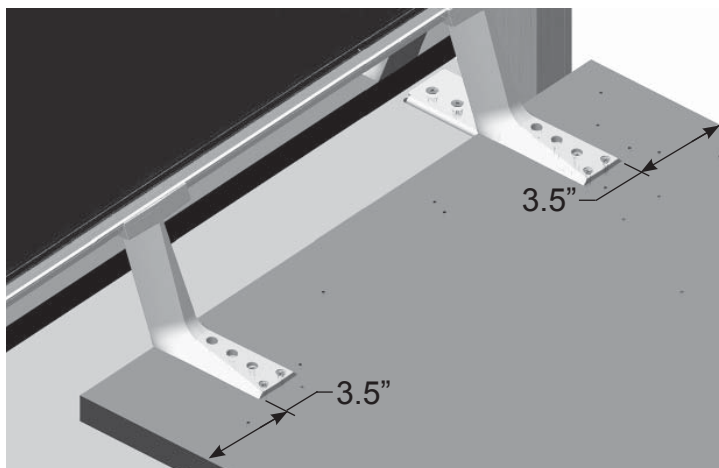

12. Determine where work surface is to be installed. Dock to Surface Tethers are to be mounted 3 1/2" in from edge of work surface.
13. Back out dock mounting screws in Dock to Surface Tethers (H) until T-nuts hang loose.
14. Insert T-nuts into groove in top rail of dock.
15. Slide top support into appropriate position. Tighten screws. Pull up on tether to ensure T-nuts are engaged in slot in rail. If not, check to see if T-Nuts are intalled properly on tethers.

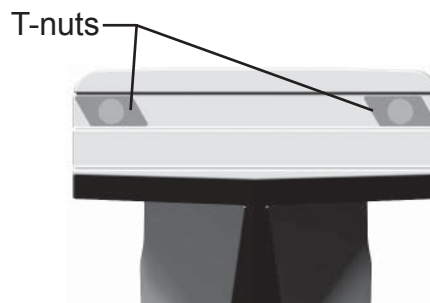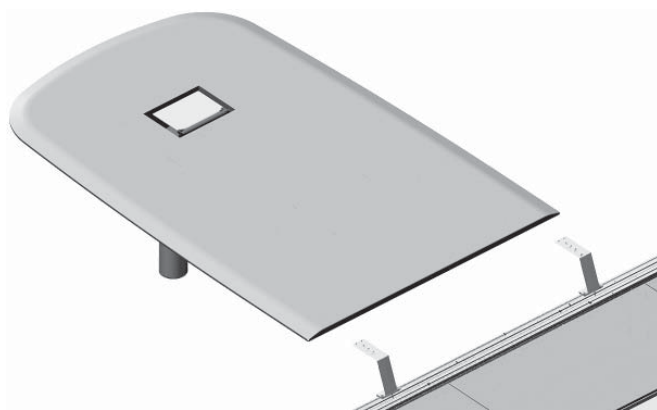

16. Place work surface assembly onto tether in proper location, with back edge of surface aligned with back edge of tether.
17. Using tethers as template, drill 5 pilot holes per tether. Be careful not to drill through top.
18. Attach work surface to supports with 5 flat head screws (J) per support.

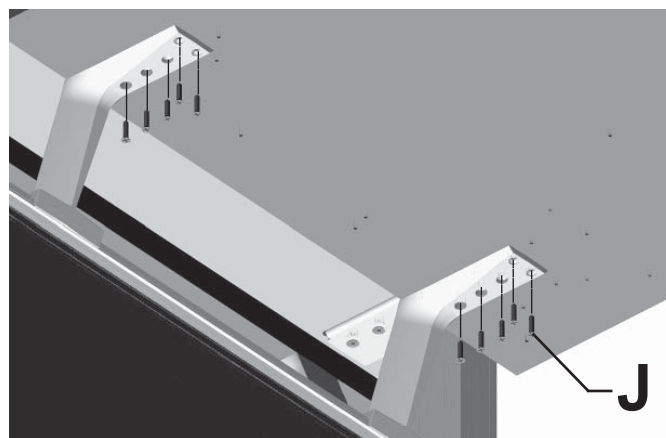

HermanMiller

© 2012 Herman Miller, Inc. Zeeland, Michigan. Printed in the U.S.A.


Part no. 1BDZ3Y rev A.

TM ®, HermanMiller, Canvas are among the trademarks of Herman Miller, Inc.


Illustrations and specifications are based on the latest product information available at the time of publication.

The right is reserved to make changes in design and specifications at any time, without notice, and also to discontinue products.

Both Mounted Peninsula:

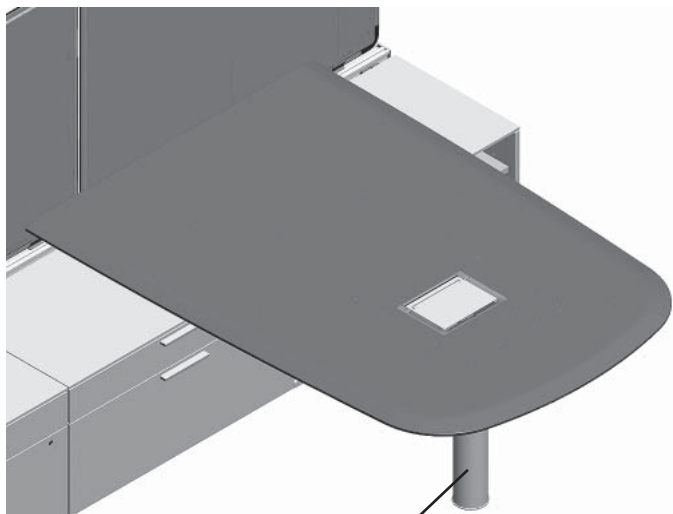

26. Level work surface by rotating leg in or out to adjust.

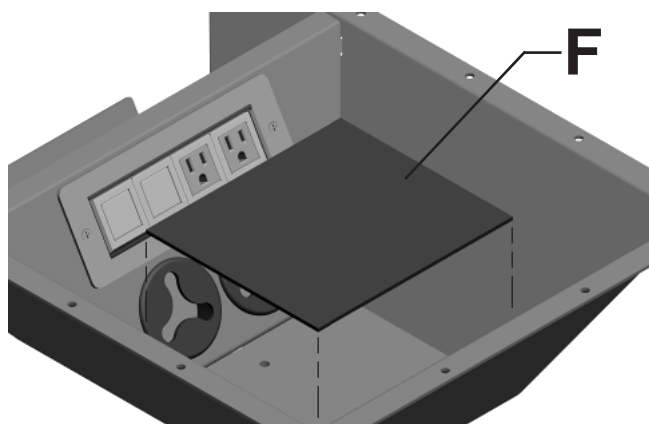

27. Place Rubber Pad (F) onto the floor of the Bottom Pan. (Note: Work Surface not shown for clarity.)

Disassembly for Recycling:

Materials Identification and Segregation:

Where possible, plastic components are marked with ASTM recycling codes. Use these codes to identify material type for recycling. Non-marked components should be treated as mixed plastic. Ferrous metals can be identified using a small magnet for recycling. Non-ferrous metals should be separated and recycled separately.

To disassemble product, reverse the above installation steps.

HermanMiller

© 2012 Herman Miller, Inc. Zeeland, Michigan. Printed in the U.S.A.

Part no. 1BDZ3Y rev A.

™, ®, Herman Miller, Canvas are among the trademarks of Herman Miller, Inc.

Illustrations and specifications are based on the latest product information available at the time of publication.

The right is reserved to make changes in design and specifications at any time, without notice, and also to discontinue products.